

User Instruction

Filtering facepieces are to be inspected prior to each use to assure there are no holes in the breathing zone other than the punctures around staples and no damage has occurred. Enlarged holes resulting from ripped or torn filter material around staple punctures are considered damage.

Before occupational use of this respirator, a written respiratory protection program must be implemented meeting all the local government requirements. In the United States, employers must comply with OSHA 29 CFR 1910.134 which includes medical evaluation, training, and fit testing.

Warning

See information supplied by the manufacturer before use these respirators. Misuse may result in sickness or death. For more information, see your occupational safety supervisor or contact with manufacturer.

Company Name: ALG Health

Address: 2106 Baltimore St.
Defiance, OH 43512
Fax: (877) 793-4877
Web: www.alg-health.com

NIOSH APPROVED: N95

Warning: These respirators do not protect the user against with gases, vapors, radioactive contaminations.

USE INSTRUCTIONS:

1. Failure to follow all instructions and limitations concerning the use of the respirator and/or failure to wear the respirator for the whole duration of

exposure to contaminants can seriously reduce the performance characteristics of the respirator and lead to illness, injury or death;

2. Before use, the wearer must first be trained by the employer in the correct use of the respirator in accordance with national regulations;

3. Before entering any contaminated area, require that the wearer be fit-tested;

4. The type and concentration of the hazardous substances must be known;

5. Discard the respirator and replace with a new one if:

. *Excessive clogging of the respirator causes breathing difficulty;*

. *The respirator becomes damaged;*

. *The respirator has exceeded its shelf life.*

6. Leave the contaminated area if dizziness, irritation or other distress occurs.

USE LIMITATIONS:

1. Do **NOT** use the respirator or enter or stay in a contaminated area under the following circumstances:

. Atmosphere contains less than 19.5% oxygen;

. Contaminants or their concentrations are unknown or immediately dangerous to life or health;

. Concentrations or contaminants exceed maximum use concentrations limit according to N95 type mask, whichever is lower;

. For sandblasting, paint-spray operations, asbestos.


2. Do **NOT** modify or misuse the respirator;

3. Do **NOT** use the respirator with beards or other facial hair that interferes with direct contact between the face and the edge of the respirator, or any

other conditions that may prevent a good face-seal;

4. One respirator mask shall not be used for more than one shift.

FITTING INSTRUCTIONS

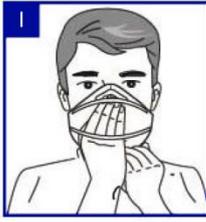

I. Cup the respirator in your hand with the nose piece at your fingertips allowing the headbands to hang freely below your hand;

II. Position the respirator under your chin with the nose piece up;

III. Pull the top strap over your head resting it high at the top back of your head. Pull the bottom strap over your head and position it around the neck

below the ears. Make sure straps are not twisted;

IV. Place the fingertips of two hands at the top of the nose piece. Mold the nose piece to the shape of your nose;

Note: Pinching the nose clip using one hand may result in a less effective respirator performance. Use two hands;

5. Cover the front of the respirator with both hands, sharply exhale and inhale, if air leaks around the nose, readjust the nose clip as described in Step 4, if air leaks at the respirator edges, work the straps back along the sides of the head to eliminate leakage. Repeat the procedure until the respirator fits properly;

Note: Do not wear with beards or other facial hair that may inhibit contact between the face and the edge of the respirator;

Warning: If you cannot achieve satisfactory fit, do not enter the contaminated area. See your Supervisor.

STORAGE AND MAINTENANCE

1. Propose to store these respirators in their original and undamaged packaging indoor with

Particulate Respirator PT-N95C-02



relative humidity of less than 70% and temperatures of between 0°C~40°C;

2.The shelf life exceeds box bottom or inner packaging printing;

3.These respirators cannot be washed or microwave-heated.